

ADHESIVE PROPERTIES AND TESTING METHODS (according to FINAT regulation)

FINAT Test Methods

Internationally approved standard methods developed by FINAT for carrying out tests of materials for self-adhesive labels.


ADHESION – Detachment strength

Definition: Strength needed for detaching an adhesive sensitive to pressure from a standard testing board to which it has been adhered under specific conditions and at a certain angle for a fixed amount of time. Adhesion strength is measured after 20 minutes and 24 hours, or after 1 week of contact time.

Testing methods: PEEL

FTM 1 - Adhesive detachment test (180°) at 300mm/min.

FTM 2 – Adhesive detachment test (90°) at 300mm/min.

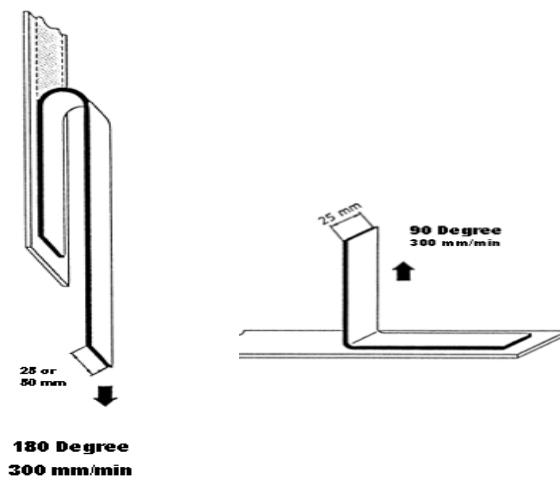

Procedure: A test strip 25 mm wide and at least 175 mm long is adhered to a standard glass plate through the exertion of pressure by a 2 kg roller. The sample is detached at an angle of 180° or 90° and at a constant speed of 300mm/min. A minimum of three strips should be used for each sample of material.

Comments:

- ✦ For a testing board, alternatives to glass substrates such as stainless steel, PE, aluminum or kraft cardboard can be used.
- ✦ Depending on the results, a preliminary classification of the adhesive as superpermanent, permanent, removable, etc. can be made.


RELEASE – Detachment strength

Definition: Strength required to separate a self-adhesive material from the silicone substrate (protective sheet) to which it is attached, forming the laminate.

FTM 3 – Detachment test at low speed.

FTM 4 – Detachment test high speed.

 Low-Speed Release



High-Speed Release



Procedure:

- ✧ For a low-speed release the strips should be 50 mm wide and at least 175 mm long. The measurement is made at an 180° angle and at a constant detachment speed of 300 mm/min. A minimum of 3 strips should be used for each sample of material. Detachment at low speed simulates the process of dispensing and applying the label.
- ✧ For a high-speed release the strips should be 30 mm wide and at least 300 mm long. The measurement is made at an 180° angle and at constant detachment speed of 150 mpm. A minimum of 3 strips should be used for each sample of material. Detachment at high speed simulates the process of die-casting and behavior during matrix stripping.

Significance

An overly rapid release can result in ruptures in the paper during die-casting or errors in the automatic dispensation of labels that do not separate smoothly from the substrate.

If the process is too slow, the labels can “fly”, that is, separate from the silicone substrate during application, or be removed with the matrix during matrix stripping.

Comments

- ✧ This property is crucial, above all, for self-adhesives in reels. This is because labels are produced in rotary machines that can reach high speeds, which means that good matrix stripping is essential. In addition, the automatic application of labels to products is also carried out at high speeds, and consequently the release is, again, an extremely important factor.
- ✧ With self-adhesive in sheets this property is not as important as with reels. Still, the release must occur within certain limits, for if it is too fast separation of the silicone substrate will be difficult, potentially causing the facestock material to tear in extreme cases. With labels with pre-scoring on the back (Kris-Line), the most important factor is that the release not be too fast so as to avoid, as much as possible, the Kris-Line tearing at other points when the two halves of the silicone substrate are separated.

TACK – Stickiness

Definition: Tack is used to measure the initial adhesion. It is the resistance strength of the adhesive facestock material adhered to a surface in specific conditions (minimum time and the contact pressure aside from that of the weight of the paper). The tack, or stickiness, is one of the most important properties of PSA, especially for reels when labels need to be applied automatically at a high speed.

Testing method: QUICK STICK

FTM 9 –Measurement of initial stickiness (“Quick Stick”)



ADHESIVE PROPERTIES AND TESTING METHODS

Procedure: An adhesive ribbon 25 mm wide and at least 175 mm long is attached to the clamp of a dynamometer. The loop is placed in contact with a stainless steel plate (or other material) in a contact area of 25 X 25 mm and is detached at a speed of 300 mm/min.

Significance: High stickiness indicates a high propensity toward bleeding and lumps, considerable ease of “attaching” to surfaces where detachment is difficult, and rupture of the facestock material in many cases. The opposite holds true for low tack. In the automatic application of labels, for example, in the case of the application of labels with a price gun to large surfaces, the self-adhesive is dispensed quickly and with little pressure. In many labeling lines, however, after the label has been applied, pressure is exerted on it by various means (rollers, brushes, rubber bands, etc.), but at the moment of application the label must remain adhered, and it is here where good tack is fundamental.

Comments

- ✦ Contrary property to cohesion: if the tack is very high, cohesion tends to be rather low.
- ✦ In addition to FINAT’s Quick-Stick testing method there are others such as ASTM’s *Polyken-Tack* and PSTC’s *Rolling Ball* methods.

COHESION – Detachment strength

FTM 8 - Resistance to guillotine detachment strength (cohesive resistance of the adhesive mass)

Definition: Resistance to the guillotining of self-adhesive film, also bonding or internal fragmentation strength of self-adhesive film in 2 pieces (on the back of the facestock material and on the surface) during the application of force.

Procedure: The test is carried out by adhering a sample strip of 25 X 25 mm to a glass plate at a vertical inclination of 2°. A measurement is taken of the time it takes a 1 kg weight to internally fragment the adhesive film of the strip. A minimum of 3 strips should be used for each sample of material.

Significance: High values indicate resistance of the adhesive to bleeding during guillotining, low tendency toward lumps, and good resistance to heat; low values indicate the contrary.

MIGRATION

Definition: Dirtying of the exterior surface of the facestock material (brownish-gray, black or greasy spots) caused by the passage of certain self-adhesive components across the facestock material.

Procedure: Visual comparison of the state of the facestock material after accelerated aging at 70°C for several days.

Comments: In the case of food labels, adhesive components can migrate across the packaging toward the food.

TORRASPAPEL, S.A. - Llull, 331 - 08019 Barcelona

© 2008 TORRASPAPEL, S.A.

Complete or partial reproduction of this document, without express previous and written authorisation, is strictly prohibited.